

MECHANICS

# TECHNICAL SERVICE BULLETIN

NO. 75-B-5



# Triumph

August, 1975

SUBJECT:  
  
ELECTRIC COOLING FANS

MODELS:  
  
TR7

The electric cooling fans situated in front of the condenser on air conditioned TR7's have in some instances been mounted incorrectly, (i.e., with the feed wires facing upwards).

Obviously, this allows water to enter the motor freely, which can result in complete motor failure. Please make a point to inspect all vehicles in stock and those which have been retailed at the next convenient service for this condition, and where necessary rotate the motor so that the feed wires point towards the ground.

Warranty claims will be accepted for this operation for a maximum of 00.30 hours.

Please note that this condition has been corrected from VIN-4500 approximately.

J.P.