

ITEM T80/025

SUBJECT: AC DELCO COIL/AMPLIFIER UNIT

MODELS: TR7

Instances have occurred where a complete coil/amplifier unit has been changed to rectify a problem which was in fact caused by poor or broken connections in the moulded plug connector from the heatsink to the coil.

Intermittent failure of the ignition is usually associated with a poor plug connection and a check of this item should be part of any ignition problem diagnosis.

The lead length and run varies on some installations. It is advantageous to route the lead above the master cylinder and secure to some location with a plastic strap which lessens the lead movement at the moulded plug.

H.C.T.

Provided Courtesy Triumph Wedge Owners Association  
<http://www.triumphwedgeowners.org>