

# TECHNICAL SERVICE BULLETIN

76-F-1

NO.



# Triumph

January, 1976

SUBJECT:

FRONT SUSPENSION TURRET


MODELS:

TR7

Water ingress at the upper mounting position of the front suspension turret can cause partial seizure of the upper bearing surface which results in heavy steering being experienced by the driver.

A simple solution to this problem is to pack the area shown in Fig. 1 with heavy grease. This operation should be carried out during pre-delivery.

Fig. 1

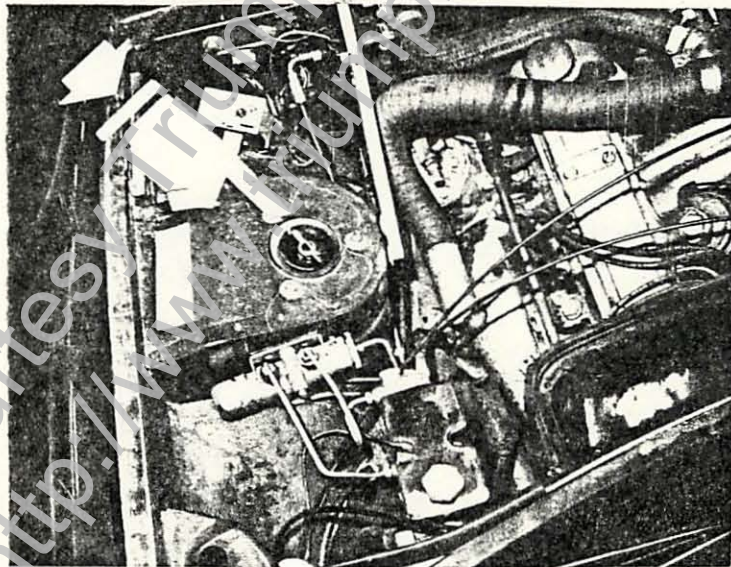

J.P.